



Environmental Monitoring Data

Project: Sydney Gateway Project

Document Number: SGWPW-JHSW-NWW-EN-RPT-059244

Reporting Period: October 2022

Date Published: 10 November 2022

Document Approval

Rev.	Date	Prepared by	Reviewed by	Approved by	Remarks
01	10/11/2022	J. Boyd	J. Paul	R. Muir	For publication

Project Summary

The Sydney Gateway Road Project ('the Project') is a new direct high-capacity road connection linking the Sydney motorway network at St Peters interchange, where the M4 and M8 motorways meet, with Sydney Airport's domestic and international terminals and the Port Botany Precinct. John Holland Seymour Whyte have been contracted by Transport for New South Wales to design and construct the works for the Sydney Gateway Road Project. Figure 1 provides an overview of the Project.

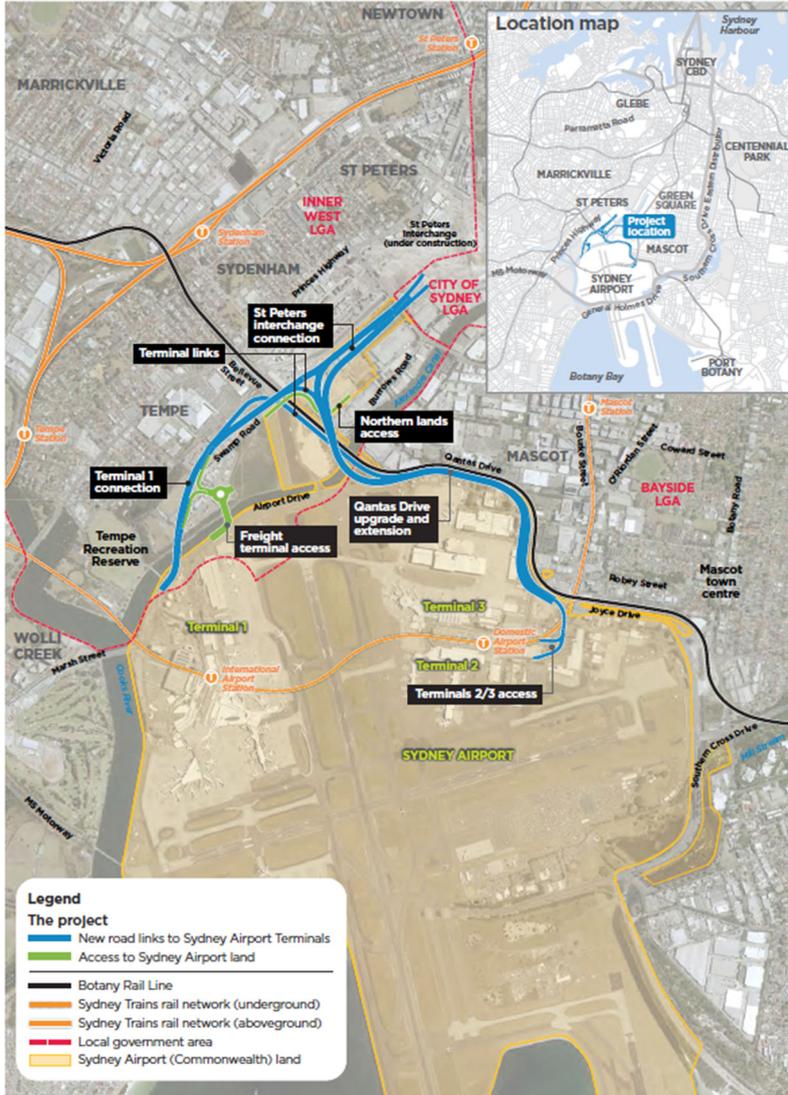


Figure 1: Project Overview

Environmental Protection Licence and Reporting Requirements

John Holland Pty Ltd obtained the Environment Protection Licence (EPL No. 21524) from the NSW Environment Protection Authority for the Project on behalf of the John Holland Seymour (JHSW) Joint Venture. The licence is for construction works relating Scheduled Activities as defined under Schedule 1 of the *Protection of the Environment Operations Act, 1997* (POEO Act).

The licence describes monitoring and reporting requirements for the Works. The following report details environmental monitoring undertaken during this reporting month conducted in accordance with the EPL.

The EPL can be found by following the link below to the EPA's website: [ViewPOEOLicence.aspx \(nsw.gov.au\)](https://www.epa.nsw.gov.au/ViewPOEOLicence.aspx)

Noise and Vibration Monitoring

Vibration

Vibration monitoring was undertaken during the reporting period, all works were deemed compliant. Table 1 contains the vibration monitoring data. Results were recorded below the adopted structural damage criteria on all occasions.

Noise

Noise monitoring was undertaken during the reporting period, all works were deemed compliant as the dominant noise source was determined to be caused by background noise sources, specifically local traffic, aircraft movements. Table 2 contains the noise monitoring results.

Discharge Water Quality Monitoring

Offsite discharge from the 30L/s WTP occurred during October 2022. All discharges were compliant. See Table 3 for sample results.

Landfill Gas and Gas Accumulation Monitoring

Landfill gas and gas accumulation monitoring was undertaken during the October 2022 monitoring period. Results are summarised in Table 4 below.

Table 1: Vibration Monitoring Data

Monitoring Location	Monitoring Date	Attended or Continuous Monitoring	Measured VDV (m/s ^{1.75})	VDV Target (m/s ^{1.75})	VDV Compliant	Measured PPV (mm/s)	PPV Target (mm/s)	PPV Compliant	Comment
Routine Monitoring (3 Hart St, Tempe)	04/10/2022 – 04/10/2022	Attended	0.10	0.4	Yes	0.16	20	Yes	Works were monitored and found to be compliant with structural and human comfort criteria
Routine Monitoring (5 Wentworth Street, Tempe)	04/10/2022 – 04/10/2022	Attended	0.22	0.4	Yes	0.34	20	Yes	Works were monitored and found to be compliant with structural and human comfort criteria.
C3 Hial Access Drainage (Desal)	04/10/2022 – 08/10/2022	Continuous	NA	NA	NA	0.35	20	Yes	Works were monitored and found to be compliant with structural criteria for the desalination pipeline.
C3 Hial Access Drainage (Desal)	11/10/2022 – 12/10/2022	Continuous	NA	NA	NA	0.34	20	Yes	Works were monitored and found to be compliant with structural criteria for the desalination pipeline.
C3 Hial Access Drainage (Desal)	13/10/2022 – 14/10/2022	Continuous	NA	NA	NA	0.18	20	Yes	Works were monitored and found to be compliant with structural criteria for the desalination pipeline.
Routine Monitoring (3 Fanning Street, Tempe)	19/10/2022 – 19/10/2022	Attended	0.09	0.4	Yes	0.14	20	Yes	Works were monitored and found to be compliant with structural and human comfort criteria.
Routine Monitoring (3 Bellevue Street, Tempe)	19/10/2022 – 19/10/2022	Attended	0.08	0.4	Yes	0.13	20	Yes	Works were monitored and found to be compliant with structural and human comfort criteria.
Routine Monitoring (4 Bellevue Street, Tempe)	28/10/2022 – 28/10/2022	Attended	0.07	0.4	Yes	0.11	20	Yes	Works were monitored and found to be compliant with structural and human comfort criteria.
Routine Monitoring (1 Hart Street, Tempe)	28/10/2022 – 28/10/2022	Attended	0.3	0.4	Yes	0.48	20	Yes	Works were monitored and found to be compliant with structural and human comfort criteria.

Note:

1. VDV – Vibration Dose Value
2. PPV – Peak Particle

Table 2: Noise Monitoring Data

Monitoring Location (Noise-Catchment Area, Street, Suburb)	Monitoring Date	Attended or Continuous Monitoring	Parameter	Measured Value dB(A)	Goals / Targets dB(A)	Comments
NCA_03, 5 Smith Street, Tempe	04/10/2022	Attended	LAeq 15min	61.2	70	Sydney Gateway works compliant. Dominant noise was traffic and construction in the building on Smith Street (unrelated to Gateway Project).
NCA_03, 3 South St, Tempe	04/10/2022	Attended	LAeq 15min	55.9	63	Sydney Gateway works inaudible. Dominant noise source was traffic and airplane noise. Sydney Gateway works compliant.
NCA_03, 3 Barden St, Tempe	04/10/2022	Attended	LAeq 15min	62.8	66	Sydney Gateway works inaudible. Traffic along Princess Highway was the dominant noise source. Sydney Gateway works compliant.
NCA_03, 6 Smith Street, Tempe	11/10/2022	Attended	LAeq 15min	59.0	69	Sydney Gateway works compliant. Dominant noise source was traffic on Smith Street.
NCA_03, 6 Wentworth Street, Tempe	11/10/2022	Attended	LAeq 15min	64.0	66	Sydney Gateway works compliant. Dominant noise source was traffic on Wentworth Street.
NCA_03, 2 Hart St, Tempe	11/10/2022	Attended	LAeq 15min	56.5	66	Sydney Gateway works compliant. Dominant noise source was traffic, aeroplanes and local fauna.
NCA_03, 11 Wentworth St, Tempe	19/10/2022	Attended	LAeq 15min	57.6	63	Sydney Gateway works inaudible. Traffic, aeroplanes and pedestrians were the dominant noise source. Sydney Gateway works compliant.
NCA_03, 2 Hart St, Tempe	19/10/2022	Attended	LAeq 15min	57.0	66	Sydney Gateway works inaudible. Traffic and aeroplanes were the dominant noise source. Sydney Gateway works compliant.
NCA_03, 8 Barden St, Tempe	19/10/2022	Attended	LAeq 15min	56.4	64	Sydney Gateway works inaudible. Traffic and aeroplanes were the dominant noise source. Sydney Gateway works compliant.
NCA_02, 4 Bellevue Street, Tempe	25/10/2022	Attended	LAeq 15min	51.3	55	Sydney Gateway works compliant. Traffic along Princess Highway was the dominant noise source.
NCA_03, 7 Barden St, Tempe	28/10/2022	Attended	LAeq 15min	66.6	66	Sydney Gateway works inaudible. Dominant noise source was traffic and airplane noise. Sydney Gateway works compliant.
NA_03, 6 Smith Street, Tempe	28/10/2022	Attended	LAeq 15min	62.5	66	Sydney Gateway works inaudible. Dominant noise source was traffic, aeroplanes and local fauna. Sydney Gateway works compliant.

Note:

1. LAeq (15min) - The A-weighted equivalent continuous (energy average) A-weighted sound pressure level of the construction works under consideration over a 15-minute period and excludes other noise sources such as from industry, road, rail and the community.
2. dBA - Decibels using the A-weighted scale measured according to the frequency of the human ear

Table 3: WTP Discharge Monitoring Data

Analyte	Units	Limit	Date 07/10/2022	Date 21/10/2022	Comments
Ammonia	ug/l	1200	47	5	Compliant
Anthracene	ug/l	0.4	<0.1	<0.1	Compliant
Arsenic (III)	ug/l	2.3	1	2	Compliant
Arsenic (V)	ug/l	4.5	1	2	Compliant
Barium (dissolved)	mg/l	2	<0.001	<0.001	Compliant
Benzo(a)pyrene	ug/l	0.2	<0.05	<0.05	Compliant
Boron	ug/l	5100	50	630	Complaint
Cadmium (dissolved)	ug/l	5.5	<0.1	<0.1	Compliant
Chromium (hexavalent)	ug/l	20	<10	<10	Compliant
Chromium (trivalent)	ug/l	49	<10	<10	Compliant
Cobalt (dissolved)	ug/l	14	<1	<1	Compliant
Copper (dissolved)	ug/l	3	<1	3	Compliant
Ethyl benzene	ug/l	110	<2	<2	Compliant
Fluoranthene	ug/l	1.4	<0.1	<0.1	Compliant
Iron (dissolved)	ug/l	300	120	140	Compliant
Lead (dissolved)	ug/l	6.6	<1	<1	Compliant

Analyte	Units	Limit	Date 07/10/2022	Date 21/10/2022	Comments
Manganese (dissolved)	ug/l	80	<1	1	Compliant
Mercury (dissolved)	ug/l	0.4	<0.1	<0.1	Compliant
m-Xylene	ug/l	100	<2	2	Compliant
Naphthalene	ug/l	70	<5	<5	Compliant
Nickel (dissolved)	ug/l	70	<1	2	Compliant
Nitrate + nitrite (oxidised nitrogen)	ug/l	15	3	<2	Compliant
Nitrogen (total)	ug/l	300	160	40	Compliant
o-Xylene	ug/l	470	<2	<2	Compliant
Perfluorooctane sulphonate (PFOS)	ug/l	0.13	<0.01	<0.01	Compliant
Perfluorooctanoic acid (PFOA)	ug/l	220	<0.01	<0.01	Compliant
pH	pH	7-8.5	7.58	7.73	Compliant
Phenanthrene	ug/l	2	<0.1	<0.1	Compliant
Phosphorus (total)	ug/l	30	27	24	Compliant
p-Xylene	ug/l	250	<2	2	Compliant
TPH C10-C36 Fraction	ug/l	600	<50	<50	Compliant
TPH C6-C9 Fraction	ug/l	150	20	100	Compliant
Turbidity	NTU	10	1.1	0.9	Compliant

Analyte	Units	Limit	Date 07/10/2022	Date 21/10/2022	Comments
Zinc (dissolved)	ug/l	23	<5	8	Compliant

Table 4: Landfill Gas Monitoring Results (25 October 2022)

EPA identification no.	Type of Monitoring Point*	Methane Limit	Results (Stabilised)%	Comment
GW1A	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW2	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW3	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW4A	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW5A	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW6A	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW7	Landfill Gas Monitoring ¹	1%v/v	-	Destroyed unable to be sampled
GW8	Landfill Gas Monitoring ¹	1%v/v	-	Destroyed unable to be sampled
GW9	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW9A	Landfill Gas Monitoring ²	N/A	12.4	Compliant
GW11A	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW12	Landfill Gas Monitoring ²	1%v/v	-	Destroyed unable to be sampled
GW13	Landfill Gas Monitoring ¹	1%v/v	-	Destroyed unable to be sampled
GW14	Landfill Gas Monitoring ²	N/A	6.8	Compliant
GW16	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW17	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW19A	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
GW22s	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
JHSW-LFG02	Landfill Gas Monitoring ¹	1%v/v	0	Compliant
OSA1	Gas Accumulation Monitoring ³	500ppm	<3	Compliant
OSA2	Gas Accumulation Monitoring ³	500ppm	<3	Compliant
OSA3	Gas Accumulation Monitoring ³	500ppm	<3	Compliant
C3 Site Compound	Gas Accumulation Monitoring ⁴	500ppm	<3	Compliant

1. Outside the passive interception and venting trench
2. Inside the passive interception and venting trench
3. Gas accumulation monitoring within buildings located outside of the landfill boundary
4. Gas accumulation monitoring within buildings located onsite